

Work Order ID 68837

Thursday, April 21, 2011 11:16:16 AM



Page 1

Item ID: D350-748-241TRN

Accept



Setup Start



Revision ID:

Stop



Item Name: Crosstube Turning Detail

Start Date: 4/21/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 5/27/2011 Req'd Qty: 1.00



Customer:

Reference:

Approvals:

Process Plan: u

Date: _____

Tooling: _____

Date: _____

Run Start



QC: _____

Date: _____

SPC (Y/N): _____

Date: _____

Stop

Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

Draw Nbr

Revision Nbr

D350-748-241

F

100



Mori Seiki

MORI SEIKI CNC LATHE LARGE

0.00

Memo

0.00

Mori Seiki CNC Lathe Large

1-Fill tube with sand & install plugs on both ends as per Folio FA647
2-Turn first side as per Folio FA647
3- File transition lines smooth.

110



QC

QC1- Inspect dimensions to dimension sheet

0.00

Memo

0.00

Quality Control

120



Mori Seiki

MORI SEIKI CNC LATHE LARGE

0.00

Memo

0.00

Mori Seiki CNC Lathe Large

1-Turn second side as per Folio FA647
2- File transition lines smooth.
3-Scribe part # as per Dwg D350-748-241

SCRAP
11/06/11

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: D350-748-241TRN PAR #: _____ Fault Category: Machining NCR: Yes No DQA: ✓ Date: 11.06.21
 Resolution: Scrap Disposition: Scrap QA: N/C Closed: ✓ Date: 11/06/21

NCR: 68837		WORK ORDER NON-CONFORMANCE (NCR) #1390.51						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
11.05.30	100	O.D. is 20.008" under tolerance in mid section of tube P.C. too much vibration from tool insert operator error	CP 11.06.01 DS1042	SCRAP/REPLACE	CP 11/06/21	CP 11-6-14 DS1042	CP 11.06.01 DS1042	Scrap

NOTE: Date & initial all entries

Work Order ID 68837

Thursday, April 21, 2011 11:16:16 AM



Page 2

Item ID: D350-748-241TRN

Accept



Setup Start



Revision ID:

Stop



Item Name: Crosstube Turning Detail

Start Date: 4/21/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 5/27/2011 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop



Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

130



QC1- Inspect dimensions to dimension sheet

0.00

QC

Memo

0.00

Quality Control

140



QC8- Inspect parts - second check

0.00

QC

Memo

0.00

Quality Control

150



Large Fab

0.00

Crosstubes

Memo

0.00

Crosstubes

Grind machining marks.

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Thursday, April 21, 2011 11:16:16 AM



Accept

**Setup Start**

Stop

**Cust Item ID:**

Customer:

Reference:

Run Start



Stop

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

[illegible]

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Thursday, April 21, 2011 11:16:13 AM

Page 1

Work Order ID: 68837



Parent Item: D350-748-241TRN



Parent Item Name: Crosstube Turning Detail

Start Date: 4/21/2011

Required Date: 5/27/2011

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:A New Issue 08-03-06 DD verified by:ec
 IPP Rev B Removed polish 08.04.02 EC verified by : DD
 IPP Rev C Removed LPS-3 08.06.23 Ec verified by: DD IPP Rev D
 11.02.24 as per dwg rev.F DD verf: JLM

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D6015-125 		Manufactured	No			120	Each	61.0000	1	1			
Crosstube Material													

Location

Loc Qty

Loc Code

HALL

61

61380

61

1 mm.l 11/05/27

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART AEROSPACE LTD		Work Order: 6837
Description: Crosstube Assembly (AS350/355 High Aft)		Part Number: D350-748-241
Inspection Dwg: D350-748-241 Rev: D		Page 1 of 1

FIRST ARTICLE INSPECTION CHECKLIST

☒ First Article ☐ Prototype

Inspection Sheet	Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	2.240	+0.005/-0.000					
	2.180	+0.005/-0.000					
	2.180	+0.005/-0.000					
	2.208	+0.005/-0.000					
	2.234	+0.005/-0.000					
	2.253	+0.005/-0.000					
	2.272	+0.005/-0.000					
	2.299	+0.005/-0.000					
	0.063	+/-0.010	.065	✓		vern	JF-01
	4.26	+/-0.030					
	R0.063	+/-0.010	.063	✓		RG	
	R0.50	+/-0.030					
SIDE B	2.240	+0.005/-0.000					
	2.180	+0.005/-0.000					
	2.180	+0.005/-0.000					
	2.208	+0.005/-0.000					
	2.234	+0.005/-0.000					
	2.253	+0.005/-0.000					
	2.272	+0.005/-0.000					
	2.299	+0.005/-0.000					
	0.063	+/-0.010	.066	✓		vern	JF-01
	4.26	+/-0.030					
	R0.063	+/-0.010	.063	✓		RG	
	R0.50	+/-0.030					
	122.70	+/-0.060	122.700	✓		tape	EL-11

Measured by:		Audited by:		Prototype Approval:	N/A
Date:		Date:		Date:	N/A

Rev	Date	Change	Revised by	Approved
A	07.01.17	New Issue (P/O D350-748-201)	KJ/JLM	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries


Item	Qty -241	Part Number	Description
1	X	D350-748-241	CROSSTUBE ASSEMBLY (AS 350/355 HI AFT)
2	1	D6015-125	CROSSTUBE (OR D6018-125)
3	2	D3502-1	SUPPORT
4	2	D2856-400-710	ABRASION STRIP
5	1	AELS-1032-225	INSERT
6	1	NAS1149D0363J	WASHER (OR AN960JD10)
7	2	MS21920-20	CLAMP (PER DART SPEC. M-MS21920-20)
8	1	MS27039-1-10	SCREW

GENERAL NOTES:

- 1) MATERIAL: MANUFACTURED FROM D6015-125 OR D6018-125
FINISHED LENGTH = 122.700±0.06
- 2) FINISH: MAGNETIC PARTICLE INSPECT PER DART QSI 038 4.2
CADMIUM PLATE PER AMS-QQ-P-416B, CLASS 1, TYPE II
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: DART PART NUMBER "D350-748-241" AND BATCH NUMBER ON INSIDE OF CUFF
PER DART QSI 044 6.4 (VIBRATING STYLUS)
- 7) WEIGHT: 29.85 lbs
- 8) PART IS SYMMETRIC ABOUT CENTERLINE, EXCEPT FOR Ø0.297 HOLE.
- 9) RUN CUTTER OFF PART WHERE INDICATED. BLEND OUT ALL EDGES FROM MACHINING
LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH. NOTE: ALL HOLES ARE DRILLED AFTER
BENDING.
- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 7 PASSES. MAXIMUM TUBE FLATTENING DUE TO
BENDING IS 6% BASED ON O.D.
- 11) HEAT TREAT TO MIN. 180 KSI PER MIL-T-6738 OR AMS 2759-1C AFTER TURNING. ACCEPTABLE TO
VERIFY TENSILE STRENGTH BY HARDNESS TEST PER ASTM E18 TO 40-45 HRC.
- 12) INSTALL D2856-400-710 ABRASION STRIPS WITH A GAP ON BOTTOM SIDE OF CROSSTUBE,
CENTERED OPPOSITE D3502-1 SUPPORT, PER QSI 035.
- 13) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE
OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES,
NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY.
CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE. WHEN DRILLING HOLES EXTREME CARE
MUST BE TAKEN AND CAREFUL DEBURRING PERFORMED TO ENSURE A CLEAN HOLE WITH NO
CRACKING/CHIPPING/GROOVES.
- 14) TORQUE CLAMPS 60 TO 80 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT
NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.
- 15) MAX TWIST AFTER BENDING: WITH XTUBE LAYED FLAT ON SURFACE, THE DIFFERENCE BETWEEN
CUFF HEIGHTS FROM THE SURFACE MAY BE NO LARGER THAN 0.25 (ZN C1-3).



RELEASED
2011-01-08

F	ADD HRC TEST OPTION (B8-1) PER PAR 09-040, ADD TWIST LIMIT (A8-1, C1-3), ADD D6015-125 OPTION (C8-1), STOCK DIM NOW MACHINED (D1-4)	CP	10.11.23
E	REVISE GENERAL NOTES; UPDATE TO CURRENT STANDARDS; RELOCATED FLAG #6 PER PAR 08-046 (ZN A8-3); ADD TOLERANCES (ZN C6-3, D2-3)	RF	09.09.30
D	MAG. PARTICLE AND CAD PLATE AS MFD.	CP	06.10.31
C	ADD CAD PLATING	CP	06.08.14
B	ADD D6018-125 & PRIME AND PAINT	CP	06.06.30
A	NEW ISSUE	OR	06.03.31
REV.	DESCRIPTION	BY	DATE
DESIGN			
DRAWN			
CHECKED			
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	10.11.23		
DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA			
DRAWING NO. D350-748-241		REV. F SHEET 1 OF 4	
TITLE CROSSTUBE (AS 350/355 HI AFT)		SCALE NTS	
<small>COPYRIGHT © 2006 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESSED CONDITION THAT IT NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>			

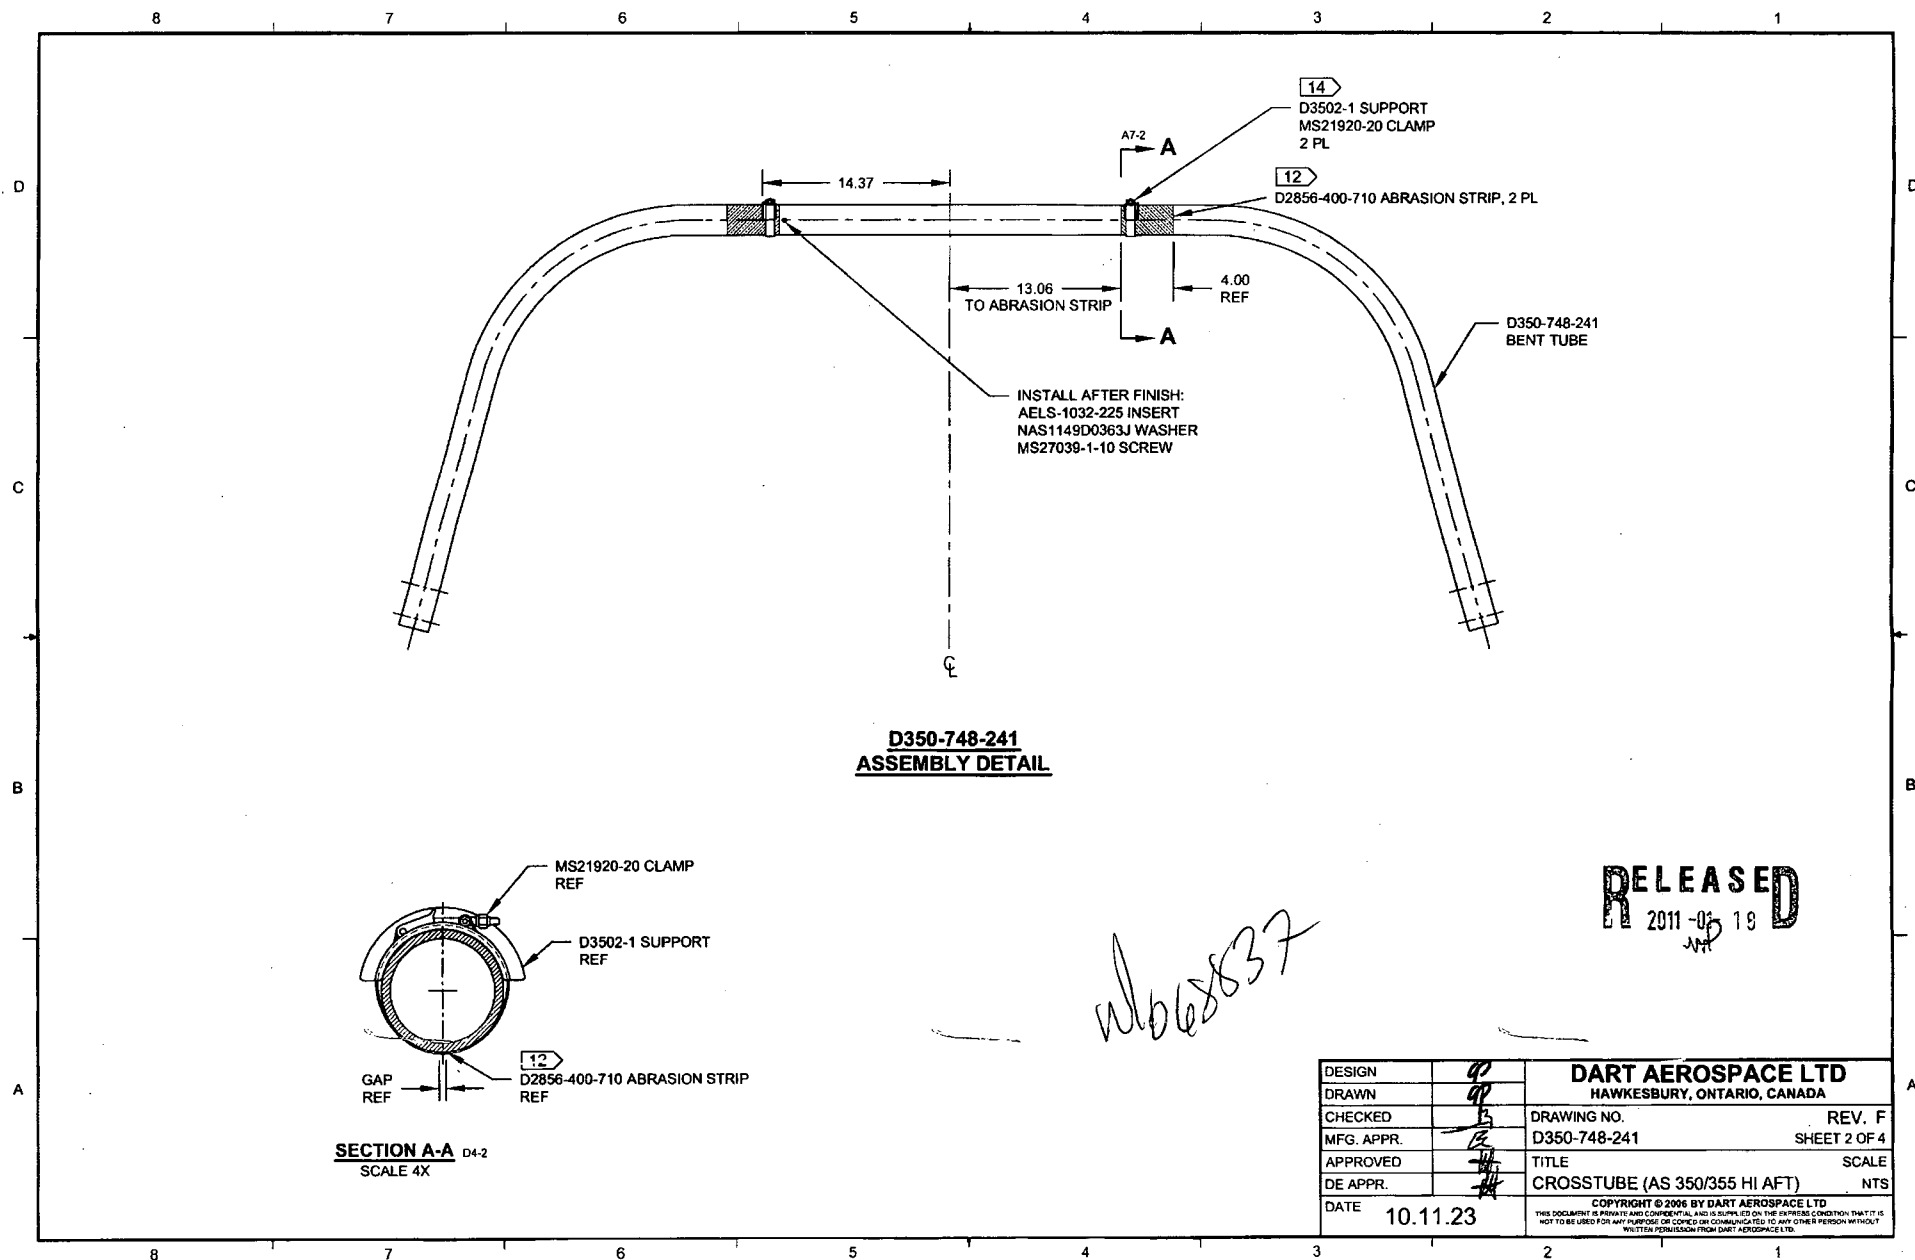

RELEASED
2011-05-19
JMT


8 7 6 5 4 3 2 1

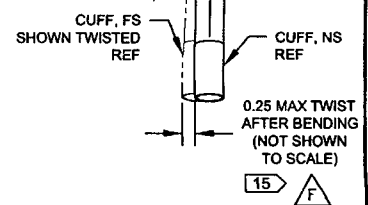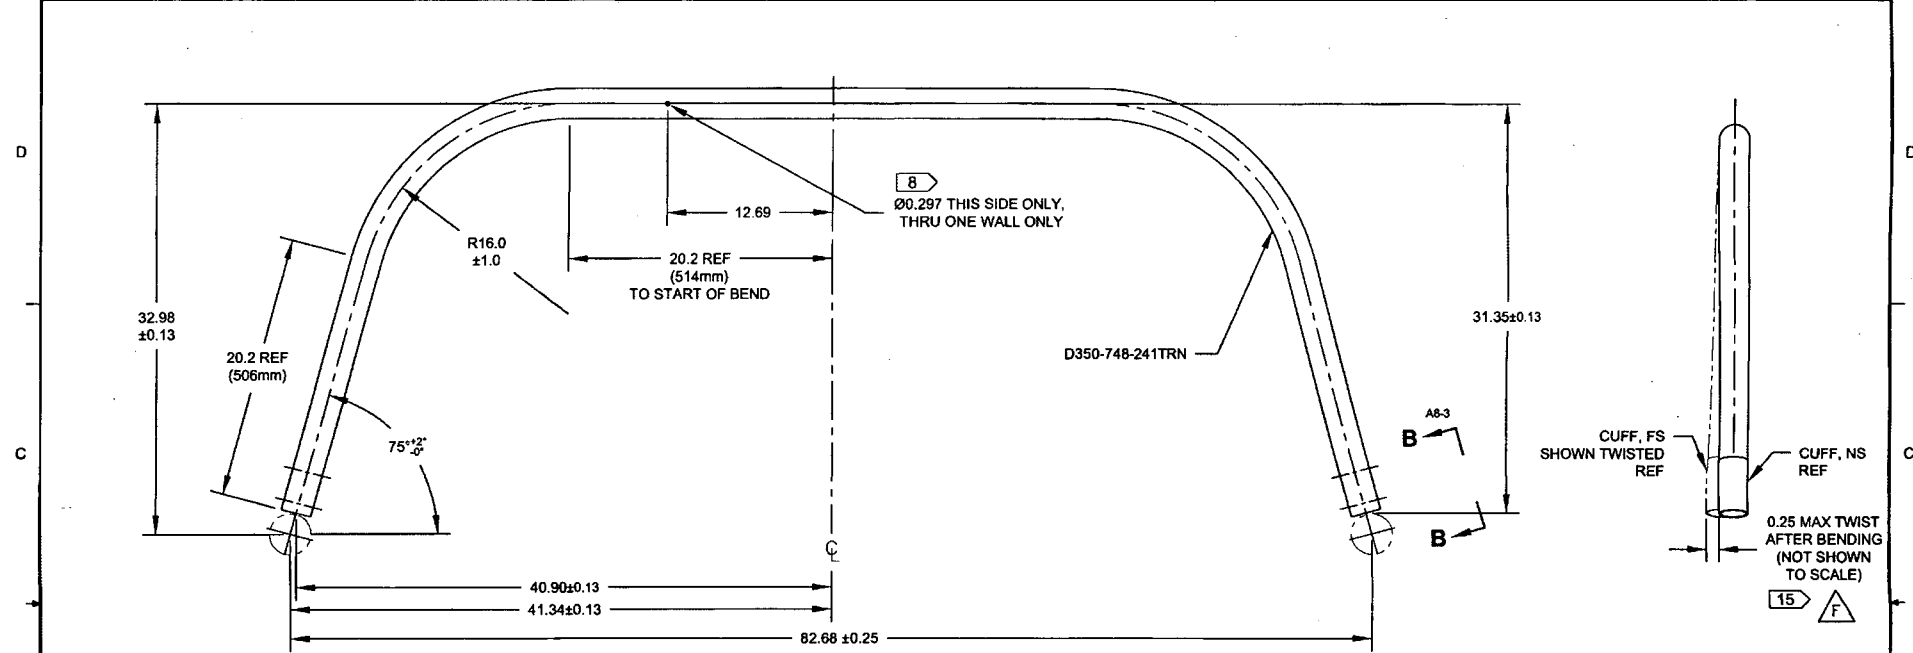

D350-748-241
BENDING AND DRILLING DETAIL 10

RELEASED
2011-01-18

68837

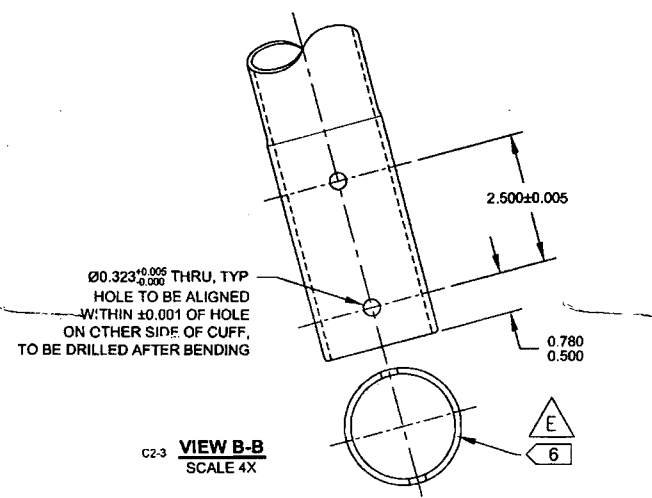

C2-3 **VIEW B-B**
SCALE 4X

DESIGN	40	DART AEROSPACE LTD	
DRAWN	40	HAWKESBURY, ONTARIO, CANADA	
CHECKED	40	DRAWING NO.	REV. F.
MFG. APPR.	40	D350-748-241	SHEET 3 OF 4
APPROVED	40	TITLE	SCALE
DE APPR.	40	CROSSTUBE (AS 350/355 HI AFT)	NTS
DATE	10.11.23	<small>COPYRIGHT © 2006 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD</small>	

8 7 6 5 4 3 2 1

